

PosiTector® 6000

Coating Thickness Gages

Full Guide v. 7.7



DeFelsko®
The Measure of Quality

Table of Contents

Introduction	1
Quick Start	1
Certification	2
Probes	4
Calibration, Verification and Adjustment	7
Menu Operation	9
Cal Settings Menu	10
Zero	10
1 Pt Adjust	11
2 Pt Adjust	11
N Lock	12
Cal Lock	12
Cal Memory	13
Setup Menu	14
Reset	14
Gage Info	15
Hi Res Mode.....	15
Fast Mode	15
Scan Mode	15
Statistics Menu	17
HiLo Alarm	17
Memory Management	18
Standard Models Menu	18
Advanced Models Menu	19
New PA2	20
New 90/10	20
Annotate	21
Display	22
Summaries	23
Screen Capture	23

Accessing Stored Measurement Data	24
PosiSoft.net	24
PosiSoft Desktop.....	24
PosiTector App	24
Connect Menu	25
WiFi.....	25
Access Point.....	25
USB.....	27
USB Serial Streaming.....	27
Sync.net Now.....	28
Bluetooth Smart.....	28
Bluetooth.....	29
Updates	30
Temperature	31
Power Supply / Battery Indicator	31
Additional Accessories	32
Bluetooth Wireless Printer	32
Troubleshooting - General.....	33
Probe takes measurements in the air	33
Thickness readings are inconsistent	33
Gage powers up but will not take readings ...	33
Gage will not print to Bluetooth wireless printer ...	33
Technical Data	34
Returning for Service	35
Warranty	35

Introduction

The **PosiTector 6000** hand-held, electronic Gage non-destructively measures the thickness of coatings on all metals, quickly and accurately. It consists of a Gage body (Standard or Advanced) and probe (integral or cabled).

Principles of Operation

F probes use the magnetic principle to measure the thickness of non-magnetic coatings on ferrous metals.

N probes use the eddy current principle to measure the thickness of non-conductive coatings on non-ferrous metals.

FN probes combine the full abilities of both the "F" and "N" probes.

PosiTector 6000 Included Accessories:

- Probe Only:


- Protective rubber holster with belt clip
- Certificate of Calibration traceable to NIST or PTB
- Protective Cap for Probe (*some probes only*)
- Quick Guide Instructions

-Gage (in addition to above Probe accessories):

- Protective Lens Shield
- Wrist strap
- 3 Alkaline AAA batteries
- Nylon carrying case with shoulder strap
- USB Cable
- Precision Plastic Shim(s)

Quick Start

The **PosiTector 6000** powers-up when the center navigation button is pressed. To preserve battery life, it powers-down after approximately 5 minutes of no activity. All settings are retained.

1. Remove the protective plastic cap (if supplied) from probe.
2. Power-up Gage by pressing the center navigation  button.
3. Place the probe FLAT on the surface to be measured. HOLD STEADY. When a valid measurement is calculated, the Gage BEEPS twice and the measurement is displayed.
4. Lift probe AT LEAST 2 INCHES (5cm) from the surface between measurements - OR - leave probe on the surface in the same location for continuous measurements.

If memory is ON while continuous measurements are being taken, only the last value on the display (when the probe is lifted) is stored into memory. **Scan** (pg.15) stores ALL measurements into memory.

Protective Cap

Some **PosiTector 6000** models are shipped with a protective plastic cap over the probe. Remove this cap prior to use.

Replace it when the Gage is not in use to protect the probe.

Wrist Strap

We recommend attaching and wearing the supplied wrist strap.



Plastic Lens Shield

The LCD is covered with a thin plastic film for protection against fingerprints and other marks during shipment. This film, while usually removed before using the Gage, can be left in place to protect against paint overspray. Replacements can be purchased.

Golden Rule


Measure your uncoated part first! This quick zero-check determines if a Calibration Adjustment is needed for your substrate. (see pg. 10)

Next, lay the included plastic shims onto a bare surface and measure them individually to ensure the Gage measures a known thickness within tolerance.


Certification

All probes include a Certificate of Calibration. For organizations with re-certification requirements, instruments may be returned at regular intervals for calibration. DeFelsko recommends that customers establish calibration intervals based upon their own experience and work environment. Based on our product knowledge, data and customer feedback, a one year calibration interval from either the date of calibration, date of purchase, or date of receipt is a typical starting point. Written calibration procedures are available from DeFelsko Corporation at no charge.

Typical Screen

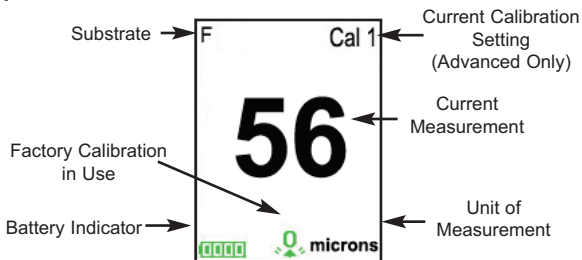

Button Functions- Normal Operation

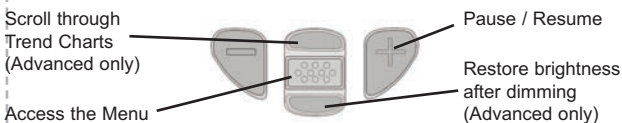

Magnetic & Eddy Current

Theory of Operation

The **PosiTector 6000** probes calculate coating thickness measurements using either the magnetic principle (**F** probes - ferrous models) or the eddy current principle (**N** probes - non-ferrous models). Combination **FN** probes (ferrous/non-ferrous) use both principles.

FN probes first attempt a measurement using the magnetic principle and will display a reading with the letter "**F**" if the coating is non-magnetic over steel. If the coating is non-conductive over metal, then the probe will *automatically* attempt a measurement using the eddy current principle and display a reading with the letter "**N**" (see also **N Lock** pg. 12).

Probes



The **PosiTector 6000** consists of a body and a probe. A wide selection of interchangeable probes are available. Each retain their own unique calibration information. Gage bodies (Standard or Advanced) accept ALL probes. See

Gage Info (pg. 15) to find your body and probe type. More probe information is available at www.defelsko.com/p6000.

To disconnect a probe from a body, slide the plastic probe connector horizontally (in the direction of the arrow) away from the body. Reverse these steps to attach a different probe. It is not necessary to power-down the Gage when switching probes.



When powered-up the **PosiTector** automatically determines what type of probe is attached and does a self-check. Coating thickness probes "sense" when they are near metal and immediately attempt a measurement followed by another every 2 seconds. They stop when removed from the vicinity of metal and power-down after 5 minutes of no activity.

This continuous measurement feature is intended to allow careful probe placement on small or odd-shaped surfaces. Ignore all readings taken before the probe is properly placed.

Two Probe Styles:

- * **Integral** - sensor protrudes from bottom of probe connector
- * **Cabled** - sensor is attached to the probe connector by a 1.2 meter (3 foot) cable.
(Extended cables lengths available.)

Available PosiTector 6000 Probes:



"Regular" - These constant-pressure, stainless steel probes are hermetically sealed to be totally waterproof - *ideal for underwater use.*

"Micro" - ideal for measuring small parts and hard-to-reach areas. Available in 0, 45 or 90 degree angles.

"Thick" - ideal for thick, protective coatings.

"Xtreme" - ideal for measuring rough and/or hot surfaces up to 250° C (500° F).

For complete details, see:

http://www.defelsko.com/p6000/p6000_probe_details.htm

Additional PosiTector Probes:

The **PosiTector** body accepts a wide variety of probe types including magnetic, eddy current and ultrasonic coating thickness, surface profile, environmental, Shore hardness durometer, salt contamination and ultrasonic wall thickness probes. See www.defelsko.com/probes



PosiTector bodies accept all PosiTector DPM, 6000, 200, SPG, RTR, SST, SHD and UTG probes

Why is Measurement Important?

Dry Film Thickness (DFT) is arguably the single most important measurement made during the application and inspection of protective coatings. Coatings are designed to perform their intended function when applied within a tight DFT range as specified by the manufacturer. Correct thickness ensures optimum product performance. Even the most basic specification will require DFT to be measured.

Many physical and appearance properties of the finished coating are directly affected by the film thickness including the color, gloss, surface profile, adhesion, flexibility, impact resistance, and hardness of the coating. The fit of pieces assembled after coating can be affected when film thickness isn't within tolerance.

Regular film thickness measurement helps control material costs, manage application efficiency, maintain finish quality and ensure compliance with contract specifications. Paint manufacturers recommend target ranges to achieve optimum performance characteristics and clients expect these parameters to be met.

Precisely measuring finish thickness has other benefits, too. Whether to meet International Organization for Standardization (ISO), quality, or customer requirements for process control, companies need to verify coating quality to avoid wasting money reworking product.

Calibration, Verification & Adjustment

PosiTector 6000 probes non-destructively measure the thickness of coatings on metals. Three steps ensure best accuracy...

1. Calibration - typically done by the manufacturer. All probes include a Certificate of Calibration.
2. Verification - typically done by the user on known reference standards such as plastic shims or coated thickness standards.
3. Adjustment - to a known thickness

Calibration

Calibration is the high-level, controlled and documented process of measuring traceable calibration standards over the full operating range of the probe, and verifying that the results are within the stated accuracy of the probe. Calibrations are performed by the manufacturer, their authorized agent, or by an accredited calibration laboratory in a controlled environment using a documented process.

PosiTector 6000 probes are shipped with a Certificate of Calibration showing traceability to a National Metrology Institution. For organizations with re-certification requirements, probes may be returned at regular intervals for calibration. DeFelsko recommends that customers establish calibration intervals based upon their own experience and work environment. Based on DeFelsko's product knowledge, data and customer feedback, a one year calibration interval from either the last date of calibration, date of purchase, or date of receipt is a typical starting point.

Written Calibration Procedures are available online at no charge.

Verification

Verification is an accuracy check performed by the user on known reference standards. A successful verification requires the Gage to read within the combined accuracy of the probe and the reference standards.


A reference standard is a sample of known thickness(es) against which a user may verify probe accuracy. Reference standards may be plastic shims, coated thickness standards, or sample parts whose coating thickness has been determined using other means.


Verify accuracy at the beginning and the end of each work shift. During the work shift, if the Gage is dropped or suspected of giving erroneous readings, its accuracy should be re-verified.

In the event of physical damage, wear, high usage, or after an established calibration interval, the probe should be returned to the manufacturer for repair or calibration.

Adjustment

Adjustment, or Cal Adjustment, is the physical act of aligning the probe's thickness readings to match those of a known thickness sample (removal of bias) in order to improve the accuracy of the probe on a specific surface or in a specific portion of its measurement range. 1-point or 2-point Cal adjustments are possible.

Probes are factory calibrated and perform an automatic self-check each time a measurement is taken. For many applications no further adjustment is necessary after a **Reset** (pg. 14). Just check ZERO on the uncoated substrate, then measure. However, sometimes probe readings can be influenced by changes in substrate shape, composition, and surface roughness or by measuring in a different location on the part. That is why Cal adjustments are made possible. The  symbol disappears whenever a Cal adjustment is made.


Where a Cal adjustment method has not been specified, use a 1-point method first. If measuring the included shims on your uncoated surface reveals inaccuracies, use the 2-point method. Factory Cal settings can be restored at any time by performing a **Reset** (pg. 14), creating a NEW Cal setting (See **Cal Memory** pg. 13), or by DELETING the adjustments made to the Cal 1 calibration setting (pg. 13). The  symbol appears on the display whenever factory Cal settings are in use.

With "FN" probes, calibration adjustments are made only to the "F" or "N" mode (stored independently under a particular Cal), whichever was measured last.


Menu Operation

Gage functions are menu controlled. To access the Menu, power-up the Gage, then press the center navigation button.

Below is a sample menu for a **PosiTector 6000** Advanced Model:

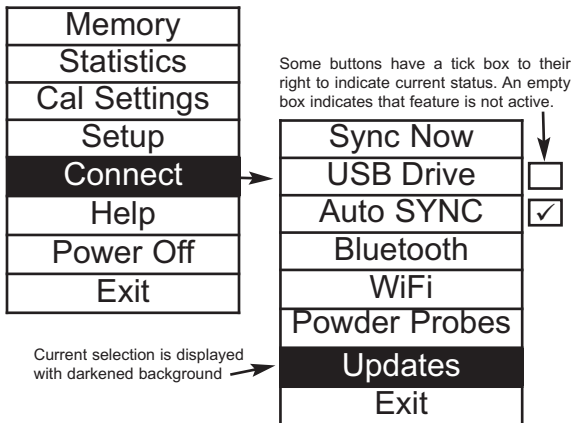

To navigate, use the Up and Down buttons to scroll vertically and  to SELECT.

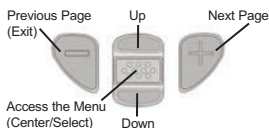

Press the (+) button to switch pages in a multipage menu.

Press the (-) button to return to the previous menu or page.

Select **Exit** to exit from any menu.

Cal Settings Menu

1-point Calibration Adjustment

Also known as an *offset* or *correction value*, there are 4 ways to perform this adjustment:

(i) Simple Zero Calibration Adjustment

Measure your uncoated part. If the Gage does not read "0" within the tolerance of the probe being used, lift the probe from the surface and adjust the display down (-) or up (+) until it reads "0". Measure and adjust until the average of a series of readings on the uncoated surface is within tolerance of "0" .

Zero

(ii) Average Zero Calibration Adjustment

To establish "0" on a rough or curved surface a preferred method to (i) is to take several readings on the uncoated part and average the result.

(a) Select **Zero** from the **Cal Settings** menu.

(b) Press (+) to select the number of readings to be used to obtain an average, typically 3 to 10 readings. The greater the variation between readings, the more readings should be taken to obtain an average.

(c) Repeatedly measure the uncoated part. The Gage will wait 2 seconds after placing the probe on the surface to allow the user to correctly position the probe on the surface. After the last measurement the Gage will calculate a Zero which represents the average of all the **Zero** readings taken.

(iii) Simple Adjustment to a Known Thickness

It is sometimes desirable to adjust the Gage to a known thickness, such as a shim, rather than adjusting it to zero.

Measure the object. If the expected reading is not obtained (within tolerance), lift the probe from the surface and adjust the displayed reading down (-) or up (+) to the expected thickness. Hold the button down to increase the rate of adjustment.


1 Pt Adjust

(iv) Average Adjustment to a Known Thickness

On rough or curved surfaces a preferred method to (iii) is to take several readings on the known thickness and average the result.

(a) Select **1 Pt Adjust** from the **Cal Settings** menu.

(b) Press **(+)** to select the number of readings to be used to obtain an average, typically 3 to 10 readings. The greater the variation between readings, the more readings should be taken to obtain an average.

(c) Repeatedly measure the known thickness reference. The Gage will wait 2 seconds between readings to allow the user to correctly position the probe on the surface. After the last measurement the Gage will calculate and display the reading which represents the average of all the measurements taken. If the expected reading is not obtained (within tolerance) lift the probe from the surface and adjust the reading down **(-)** or up **(+)** to the expected thickness and press .

2 Pt Adjust

2-point Calibration Adjustment

Preferred method for very unusual substrate materials, shapes or conditions. Provides greater accuracy within a limited, defined range.

1. Select **2 Pt Adjust** from the **Cal Settings** menu.

2. Press **(+)** to select the number of readings to be used to obtain an average on the thinner item, typically 3 to 10 readings. The greater the variation between readings, the more readings should be taken to obtain an average.


3. Repeatedly measure the thinner item. The Gage will wait for 2 seconds on the surface to allow the user to correctly position the probe on the surface. After the last measurement the Gage will calculate and display a thickness value which represents the average of all the readings taken using the factory calibration settings.

4. Lift the probe from the surface and adjust the displayed reading down (-) or up (+) to the known thickness value of the thin item. Press to accept this value.

5. Repeat steps 2 - 4 for the thicker item.

Cal Lock




When selected, the  icon will appear and all calibration settings are “locked” to prevent further user adjustments. Uncheck to make further adjustments.

N Lock



(FN ferrous/non-ferrous combination probes only)

Select **N Lock** (Non-Ferrous Lock) when operating regularly on non-ferrous substrates. The  icon will appear and the probe will only use the eddy current principle to shorten measurement time and extend battery life.

N Lock is useful when measuring coatings on plated steel. Normally the probe measures both the coating + plating over the steel using the magnetic principle. N Lock makes the Gage measure the coating over the plating only.

Select **N Lock** to measure over slightly magnetic substrates; i.e. clear-coat on gold over nickel-plated brass. Although the probe's magnet is used for the magnetic principle, it is also used in N Lock to magnetically saturate a slightly magnetic substrate and allow the eddy current principle to operate unhindered.

CAUTION: With N Lock engaged it is possible to obtain a reading when measuring non-conductive coatings on steel. This is not recommended.

Calibration Memory


Cal Memory (Advanced models only)

It is often convenient to store a particular calibration adjustment before making another. Then, if you return to that part, the corresponding calibration setting can be restored.


A “setting” is any calibration adjustment. The **PosiTector 6000** always displays the current calibration setting (ex. **Cal 3**) in the upper right corner of the display.

The setting called **Cal 1** has unique features. It can be adjusted but never deleted, and is always made active with factory settings after a **Reset** (pg.14).

New

Creates a new calibration setting using the next available number (Maximum of 10). By default, these new Cal settings are initially created with the Gage’s factory settings. This is indicated with the  icon which appears at the bottom of the display. A warning message will prevent the creation of a new **Cal Memory** if a batch is open and has readings. Delete the batch first (pg. 21).

Open

Loads an existing setting. Use the **Up** or **Down** buttons to scroll until the desired setting appears, then press  . A warning message will prevent the opening of a stored Cal setting if a batch is open and has readings. Create a new batch first or open a batch containing no readings (pg. 21).

Delete

Removes a setting completely from the list. That Cal number can be reused later with the New command. A setting cannot be deleted if readings have been stored into a batch using that calibration setting. Delete all readings in that batch first (pg. 21). Although **Cal 1** cannot be deleted, the **Delete** function will return it to factory settings.


View

View stored Calibration Settings.

Setup Menu


Reset

Reset (menu reset) restores factory settings and returns the Gage to a known condition. The following occurs:

- All batches, stored measurements, images, and batch names are erased.
- The  icon will appear on the display.
- Menu settings are returned to the following:

Memory = OFF	Cal Lock = OFF
High Res = OFF	Bluetooth = OFF
Statistics Mode = OFF	Display = None
Hi Lo Alarm = OFF	N Lock = OFF
Scan Mode = OFF	

Perform a more thorough **Hard Reset** as follows:

1. Power down the Gage and wait 5 seconds.
2. Simultaneously press and hold the (+) and  center buttons until the **Reset** symbol appears.

This returns the Gage to a known, “out-of-the-box” condition and performs the same function as a menu **Reset** with the addition of:

- All calibration adjustments and Cal Memory are cleared and returned to the Gage’s factory calibration settings.
- Bluetooth Pairing info is cleared.
- Menu settings are returned to the following:

Units = microns	Language = English
Flip Display = Normal	Battery Type = Alkaline
Auto Sync = OFF	Backlight = Normal
Fast Mode = OFF	Bluetooth Streaming = OFF
	USB Drive = ON

- NOTES:**
- Keep the Gage away from metal during a **Reset**.
 - Date, Time and WiFi are not affected by either **Reset**.

Backlight

Selects display brightness (Sun, Normal or Night). All settings will dim slightly after a period of no activity to conserve battery life. Press the **Down** button to brighten the display.

Hi Res

Increases the displayed Gage resolution as follows:

Resolution	Range
0.01 mil	0.00 - 99.00 mils
0.1 mil	100.0 - 999.9 mils
0.1 um	0.0 - 999.9 um
1.0 um	over 1000 um

NOTE: Gage accuracy is not affected.

Fast

Increases measurement speed for most probes. Useful for quick inspection or when measuring large areas with thick coatings where proper probe positioning is not critical. Swift up/down probe movement is required. Reduced accuracy may be noted.

Scan

(Advanced models only)

By default, the PosiTector 6000 takes approximately 1 reading per second. **Scan** mode allows the user to take multiple readings in rapid succession (3 readings per second) without lifting the probe. Choose from 3 **Scan** modes:

- Normal** - continuously measures when placed on the surface
- Statistics** - displays real-time scan statistics when placed on the surface. Average, max., min., and standard deviation are displayed.
- Limited # Avg.** - continuously measures until user-specified number of readings is reached, then displays the average for the scan.

When **Memory** is on (pg.6), **Scan** measurement data is recorded. However, in **Statistics** and **Limited # Avg. Scan** modes, only the statistics and/or average is saved, not individual readings. Note that performing a scan may reduce the life of the probe and is recommended for smooth surfaces only. For additional information concerning **Scan** mode, visit <http://www.defelsko.com/scan>

Gage Info

Displays the model number & serial number, probe type & serial number, PosiSoft.net registration key, the amount of remaining memory for storage of readings, date and time, and software packages.

For security purposes, the registration key is required to add the Gage to your free PosiSoft.net account.

Flip Display

This option causes the display to rotate 180°. Ideal for right-side-up viewing when the sensors are pointed away from the user.

Set Clock

All measurements are date and time stamped (24 hour format) when stored into memory. It is therefore important to keep both the date and time current using this menu option. Use the **Up** and **Down** buttons to scroll, and the **(-)** and **(+)** buttons to adjust a value. The Gage's data and time can also be viewed in **Gage Info** (pg. 15).

Battery Type

Selects the type of batteries used in the Gage from a choice of "Alkaline", "Lithium" or "NiMH" (Nickel-metal hydride rechargeable). If NiMH is selected, the Gage will trickle charge the batteries while connected via USB to a PC or optional AC charger (Gage must be powered ON). The battery state indicator icon is calibrated for the selected battery type. No damage will occur if the wrong battery type is selected.

DeFelsko recommends *eneloop* (NiMH) rechargeable batteries.

Units

Converts the display from inch to metric or vice versa. Stored measurements in memory are not converted. Switching units will turn off Statistics, HiLo Alarm and closes Memory.


Language

Converts displayed and printed words to the selected language.

Statistics Menu

Statistics

When selected, a \bar{x} icon and statistical summary will appear on the display.

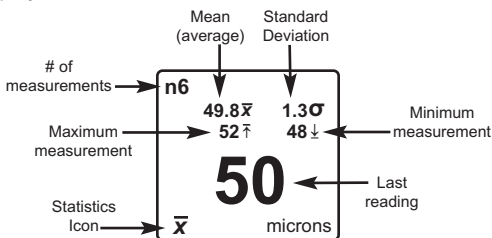

Remove the last measurement by pressing the (-) button. Press (+) to clear statistics.

HiLo Alarm

Allows the Gage to visibly and audibly alert the user when measurements exceed user-specified limits.

When **HiLo Alarm** is selected, the current **Lo** setting is displayed. Adjust down (-) or up (+). Alternatively, measure a coating with a thickness close to the required value and make final adjustments with the buttons. Select **NEXT** to accept this value. The current **Hi** setting is now displayed. Follow the same procedure to adjust the **Hi** setting.

The **II** icon will appear on the display.


Measurements will be compared to your defined **HiLo** limits. The Gage beeps if results are within those limits. A single low tone will sound if the reading is below the **Lo** limit, and a high tone if it is above the **Hi** limit. Press (+) to clear **HiLo** readings.

Clear


Clears all on-screen **Statistics** and **HiLo** tabulations.

Memory Management

The **PosiTector 6000** has internal memory storage for recording measurement data. Stored measurements can be reviewed on-screen or accessed via computers, tablets and smart phones. Measurements are date and time-stamped.

The  symbol appears and basic statistics are displayed when the Gage is set to store measurement data.

Button functions with **Memory ON**:

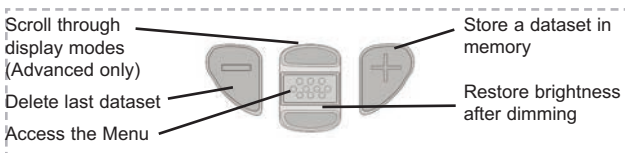


Standard models store up to 250 readings in one batch. The **Memory** Menu includes the following options...


On: turns memory on and begins recording

Off: stops recording (stored readings remain in memory)

Clear: removes all readings from memory

View: lists group statistics and all stored readings on the display. It will begin by showing statistics based on all readings in memory. Use the **Up** and **Down** buttons to scroll through all readings. Press  to exit.

Standard model display with **Memory ON** shows measurement statistics:

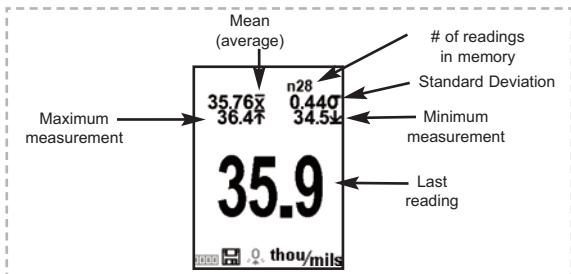


Advanced models store 100,000 readings in up to 1,000 batches. The **Memory** Menu includes the following options...

New Batch

Closes any currently opened batch and creates a new batch name using the lowest available number. For example, if only **Batch 1** and **Batch 3** exist, then **Batch 2** would be created and made the current batch. Each measurement will be displayed and stored into this new batch. On screen statistics are immediately updated with each measurement. New batch names are date stamped at the time they are created.

Shortcut: When a batch is open, press (+) to create a new batch

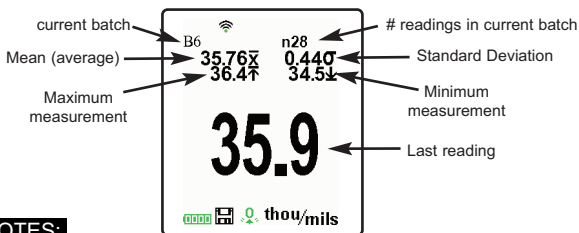

NOTES:

- Remove the last reading from the current open batch by pressing (-).
- Calibration adjustments cannot be made if readings are stored in memory.


New Sub-Batch

(appears only if a batch is currently open)

Creates a new sub-batch within the currently opened batch.

Shortcut: When a sub-batch is open, create a new sub-batch by pressing (+)

In the following example, **B2s2** is a sub-batch of **Batch 2**. Sub-batching allows the user to group related batches so that statistics can be accumulated for them. **Batch 2** contains the statistics for **B2s1** and **B2s2**.

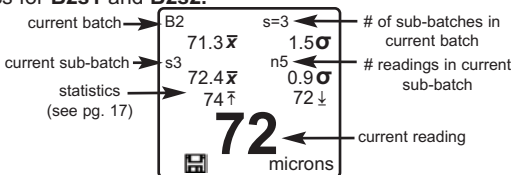

New PA2

Helps determine if film thickness over a large area conforms to user specified min/max levels. See www.defelsko.com/pa2


New 90/10

Determines if a coating system complies with the IMO performance standard for protective coatings.

See www.defelsko.com/9010

Open

Selects a previously created batch or sub-batch name to open and make current. If it contains measurements, on-screen statistics will immediately reflect values calculated from this batch. The calibration setting (i.e. Cal 2) associated with this batch is also opened (pg. 13).

NOTE: A solid triangle \blacktriangleright is displayed to the right of the batch name when sub-batches are present. Press  to view sub-batches. This also applies to the *Delete*, *View* and *Print* options.


Close

Stops the recording process, closes the current batch, and removes batch information from the display.

Delete

Removes a batch or sub-batch completely from memory. The name is deleted and all measurements are erased. Sub-batches can be deleted individually. To delete all related sub-batches, simply delete the top-level batch.

View

Scroll using the **Up** or **Down** buttons through information, statistical summary, and a list of each reading in the currently opened batch. Press  to exit.

Annotate

(Advanced models only)

Create meaningful batch names and enter notes directly on the Gage using a familiar onscreen *QWERTY* keyboard.

Use the Gages navigation and **(-)(+)** buttons to enter annotations.

Annotations can be synchronized with PosiSoft.net and the PosiTector App and are included in PosiSoft USB Drive reports.

Print


Sends a statistical summary and individual measurements to the optional Bluetooth wireless printer.

NOTE: To cancel printing, press and hold the **(-)** and **(+)** buttons simultaneously




Display*(appears only if a batch is currently open)*


The following user selectable display options are available:

 **Chart:** A real-time chart of batch readings
x-y Chart for

Single Layer Application

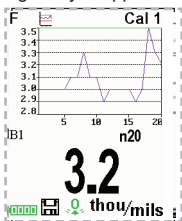

 **Notes:** Instructions, descriptions or notes (see **Annotate**, pg.21)

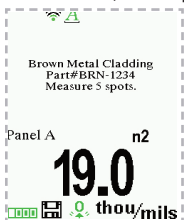

None: Default screen shows statistics

Shortcut: When a batch is open, press **Up** to scroll through the above display options.

NOTES:

- PosiSoft.net and the PosiTector App are used to insert an **Image** and **Notes** into a batch.
- Remove the last reading from the current open batch by pressing (-).
- Calibration adjustments cannot be made if any measurements were taken with that setting and stored into a batch.
- If memory is ON while continuous measurements are being taken, only the last value on the display (when the probe is lifted) is stored into memory. **Scan Mode** stores ALL measurements into memory (pg. 15).
- Each batch can contain a maximum of 10,000 readings.

Summaries (Advanced models only)

Displays a summary of all stored batches including the name, probe type, number of readings and type.

In the following example, Batch 3 (B3) indicates an "F" 6000 coating thickness probe was used to record a total of "6" readings in "PA2" mode.



Batch Name	Probe Type	#	Type
B4	SPG	20	
B3	F	6	PA2
B2	F	10	
B1	UTG-C	5	

OK

Screen Capture

Press both (-)(+) buttons at any time to capture and save an image copy of the current display. The last 10 screen captures are stored in memory and can be accessed when connected to a computer (see **PosiSoft USB Drive** pg. 27).

Sample Screen Captures

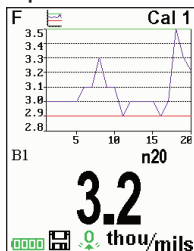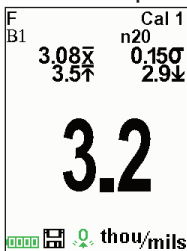

Accessing Stored Measurements Data

DeFelsko offers the following free solutions for viewing, analyzing and reporting data:

PosiSoft USB Drive - Connect the Gage to a PC/Mac using the supplied USB cable. View and print readings and graphs using universal PC/Mac web browsers or file explorers. No software or internet connection required. **USB Drive** must be selected in the Gage's "**Connect > USB**" menu (pg. 24).



PosiSoft Desktop - Powerful desktop software (PC/Mac) for downloading, viewing, printing and storing measurement data. Includes a customizable, templated PDF Report Generator. No internet connection required.

PosiSoft.net - Web-based application offering secure, centralized storage of measurement data. Access your data from any web-connected device.

PosiTector App - (*Advanced models only, s/n 784000+*) App for compatible iOS and Android smart devices. Permits users to create, save and share professional PDF reports. Add images and notes using the smart device's camera and keyboard.

Learn more at <http://www.defelsko.com/posisoft/posisoft.htm>

Connect Menu




WiFi

(Advanced models only)

Allows connection to your local wireless network or mobile hot spot. Ideal for using your network's internet connection for synchronizing stored measurements with PosiSoft.net (pg.24). See www.defelsko.com/wifi

Enable




Turns WiFi functionality **ON**. When selected, the  icon will appear on the display. To deactivate WiFi, uncheck the Enable box.

Access Point




Connect your smart device/computer to a PosiTector Advanced body wirelessly without the need for a separate network. Wirelessly import readings into PosiSoft Desktop v4.0 Software whenever a WiFi network is not available or out-of-range.

To enable, select **Access Point** from the **Connect > WiFi** menu. The Access Point icon  will display in the upper left of the PosiTector display.

Securing your Access Point -

To ensure the PosiTector is only accessible to authorized devices, it is important that you enter a passphrase (password) for the Access Point. The default Passphrase is **password**.

In the **Connect > WiFi > Setup** menu, select **AP Passphrase**.


Press  button to display on-screen keyboard. Enter a Passphrase for the Access Point. The Passphrase will be required for all devices connecting to the PosiTectors Access Point.

The PosiTector is now visible to all WiFi enabled devices. Simply connect your devices WiFi to the new PosiTector Access point. All PosiTectors are uniquely identified by their respective gage body serial numbers.

AP Channel - Default Channel: 6

For most users the default channel will not have to be altered. If you are experiencing poor connection or are unable to connect, try another channel.

In the **Connect > WiFi > Setup** menu, select **AP Channel**.

Press the **UP** center navigation button to highlight the channel. Use the (-) or (+) buttons to change the channel. Press the **DOWN** navigation button and select **OK**. Press the  button.

Networks: With WiFi Enabled (pg. 11) the Gage will allow the user to add a new network and will automatically check for available local networks. Available networks detected by the Gage are listed on the screen along with any networks that the Gage has previously been connected to that are not currently within connection range.

Information: Gage displays information about the local WiFi network connection including...

- **SSID:** the network's name
- **State:** displays if the Gage is connected to the network or not
- **IP Address:** the network's IP Address

Setup: Allows user to setup a WiFi connection

- **IP Settings:** enter the IP information as follows...

IP Type (DHCP or Static), IP Address,
Gateway, Netmask, DNS1, DNS2

- **Server Enable:** enables a connection between the network and the Gage
- **Gage Name:** enter a name for the Gage (up to 14 Characters).

AP Channel: The access point channel corresponding to a frequency range. (Default Channel: 6)

AP Passphrase: A series of characters, numbers or symbols used to log on to a WiFi network. (Default Passphrase: password)

- **WiFi Reset:** erases all WiFi settings

USB

When **USB Drive** is checked the **PosiTector** gage uses a USB mass storage device class which provides users with a simple interface to retrieve stored data in a manner similar to USB flash drives, digital cameras and digital audio players.

USB Drive is also required to import stored measurements into PosiSoft Desktop software (pg.24). Once connected, any computer can view measurements stored in memory by navigating a virtual drive labeled "PosiTector" using the included USB cable.

A formatted HTML report is viewed by selecting the "index.html" or "START_HERE.html" file found in the root directory. Optionally, text ".txt" files located in each batch folder provide access to measurement values. Stored datasets and graphs can be viewed or copied using universal PC/Mac web browsers or file explorers.

When your **PosiTector** is first connected to your Windows PC via a USB cable, an enumeration process is started that installs device drivers without re-booting your computer. You may see several pop-up windows in the taskbar at the bottom right of your screen. Wait for the entire process to be completed before proceeding.

Serial Streaming via USB (Advanced models only, serial numbers 784000 and greater)
Advanced gage bodies have the ability to serial stream live readings from the USB port

The following document links will help operators use this feature:

PosiTector Advanced USB Serial Streaming Instructions --
<http://www.defelsko.com/usb/PosiTectorAdvanced-USBserial.pdf>

Required driver (referenced in above document) --
<http://www.defelsko.com/usb/gserial.zip>

Retrieving stored screen captures:

The last 10 screen captures stored in memory can be accessed by navigating to the "screen capture" directory within the "PosiTector" virtual drive.

NOTE: When connected, power is supplied through the USB cable. The batteries are not used and the body will not automatically power down. If rechargeable (NiMH) batteries are installed, the instrument will trickle charge the batteries.

Sync .net Now

The below **WiFi**, **USB** and **Bluetooth** menus contain a **Sync .net Now** option. When selected, the Gage immediately synchronizes stored measurement data via its respective communication method (internet connection required).

Alternatively, select **Auto Sync .net** from within the **USB** connect menu to automatically synchronize upon connection to a PC. Additional measurements added to memory while connected are synchronized only when the USB cable is disconnected and reconnected, or when the **Sync .net Now** option is selected.

WiFi connected gages automatically attempt synchronization upon power-up.

NOTE: PosiSoft Desktop (pg. 24) is required when using **USB** or **Bluetooth** connections to synchronize measurements with PosiSoft.net.

Bluetooth Smart (Advanced models only, serial numbers 784000 and greater)



When **Enabled** , allows communication with a smart device running the PosiTector App (pg. 24) via auto-pairing Bluetooth Smart (BLE) wireless technology.

Select batches to flag them for synchronization to the PosiTector App. New batches created while **Bluetooth Smart** is enabled are automatically selected.

Sync Batches

With **Bluetooth Smart** enabled, select **Sync Batches** to transfer selected batches to the PosiTector App. This is useful when switching between smart devices, as only readings and batches that have yet to be synchronized with any smart device are synchronized automatically.

NOTE: If **Bluetooth Smart** is disabled, data from batches selected in the **Sync Batches** menu are held in a queue until communication with the PosiTector App is re-established.

Send Batches

Transfers selected batches to the PosiTector App (useful when switching between devices).

The **Send Batches** option is visible in the menu when the Gage is connected to a smart device running the PosiTector App.

Bluetooth

(Advanced models only)



Allows individual readings to be sent to a computer, printer or compatible device as they are taken using Bluetooth wireless technology. See www.defelsko.com/bluetooth

Pairing

The instrument and receiving device must be paired before stored or streamed datasets can be transmitted. For pairing instructions, see <http://www.defelsko.com/bluetooth>

Info

Lists information about your current Bluetooth connection, including the currently paired device and MAC address.

Stream

When checked, the instrument will stream datasets to the paired Bluetooth Device as they are taken. Datasets can be streamed as they are taken to the optional Bluetooth printer or third-party computer software.

Powder Probes


Displays menu options that enable the PosiTector Advanced body to communicate with wireless PosiTector PC probes. See <http://www.defelsko.com/pc>

Updates

Determines if a software update is available for your Gage. If an update is available, a prompt will appear allowing the user to choose to perform the update at this time or not.

To perform an update the Gage must be connected to an internet connected computer with *PosiSoft Desktop* (pg. 24), or **WiFi** network (pg. 24).

NOTE: Ensure that stored measurements are backed up to a PC or *PosiSoft.net*. The Gage may perform a **Hard Reset** (pg. 14) after completion of the update and ALL readings in memory will be erased.

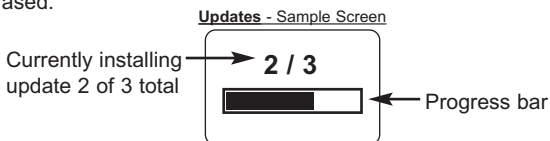

 **DO NOT** unplug the Gage during the update operation.

Temperature



Operating Range: +32° to +120°F (0 to +50°C)


The **PosiTector 6000** compensates automatically for temperature. Allow a few minutes for the probe to reach ambient temperature before measuring.

Discard the first measurement taken in a notably different temperature condition. When measuring surfaces much hotter or colder than ambient, lift the probe at least 6 inches (15cm) and allow at least 1 second off the surface between measurements.

Power Supply / Battery Indicator

Power Source: 3 AAA alkaline, Lithium or optional Nickel-metal hydride (NiMH) rechargeable batteries. For best battery indicator results, ensure the appropriate **Battery Type** is selected in the **Setup > Battery Type** menu (pg. 16).

The battery indicator  displays a full bar with fresh alkaline or fully charged batteries installed. As the batteries weaken, the bar will be reduced. When the battery symbol is low  the Gage can still be used, but the batteries should be changed or recharged at the earliest opportunity. The Gage will turn off automatically when batteries are very low, preceded by a Low Battery Warning on the display.

 To retain all user settings and stored memory readings, only replace the batteries after the Gage has powered-down.

Battery performance decreases at low temperatures.

Additional Accessories

AC Power Cable Kit

An optional AC Power Cable Kit is available for continuous operation or battery charging through the **PosiTensor's** built-in USB port (as shown on pg. 24). This kit supplies several alternate power solutions for your battery-operated **PosiTensor**. They allow the gage to operate continuously without the need for batteries.

Use the cable alone to connect a **PosiTensor** to your PC's built-in USB port that acts as a continuous power source. Or connect the cable to the included power adaptor which plugs into any AC wall electrical outlet, 110 or 220V.

A selection of electrical plugs is included which are capable of dealing with most country's outlets. The USB cable provided can also be used for **Accessing Stored Measurement Data** (See pg. 24).

USB Cable

A USB Cable is provided with every **PosiTensor**.

Bluetooth Wireless Printer

PosiTensor Advanced models can output to the optional battery powered Bluetooth wireless printer one of two ways:



- Stream individual readings as they are taken.
- Print stored batch readings and summaries.

Begin by entering the **Connect > Bluetooth** menu. Turn Bluetooth **ON** and "**Pair**" the **PosiTensor** to the printer. See: www.defelsko.com/bluetooth

Streaming: In the **Connect > Bluetooth** menu, select the **Stream** tick box. All readings will now be simultaneously displayed on the LCD and sent to the printer.

Printing: In the **Memory** menu, select **Print**.

Troubleshooting

Most conditions can be cleared with a **Hard Reset** (see pg. 14). If not, visit our Service & Support page for information on sending your Gage to us for a no charge evaluation.

See: <http://www.defelsko.com/service>

Probe takes a measurement even while held in the air:

The probe may have been left near metal, including jewelry, during power up or at rest. Possibly a finger was held over the probe. Try measuring on an uncoated object. Otherwise turn the Gage off, and then on again. Finally try a **Reset** (pg. 14).

Thickness readings are inconsistent:

- Probe tip may be damaged, scratched or worn
- Make sure you lift the probe well clear of the surface between measurements
- Try measuring on a different surface with the included plastic shims
- Hold the probe on the surface and allow it to take several measurements. If the second and subsequent measurements are consistent, you are not putting the probe onto the surface fast enough.
- The substrate and/or coating surface is uneven, in which case inconsistent readings are to be expected. Take several measurements and average them to get a meaningful result.

Gage powers up but will not take any readings:

- Substrate may not be metal. "F" probes measure coatings on ferrous metals such as steel and iron, and "N" probes measure over non-ferrous metals such as aluminum.
- Protective cap must be removed from probe (if outfitted with one).
- An extreme calibration adjustment might have been made.

Gage will not print to the Bluetooth wireless printer:

- Ensure the Gage has been paired for use with the printer and the Gage menu option **Connect > Bluetooth > Stream** box is ticked.
- Check printer batteries. Switch it off and then on again.

Technical Data

Measuring Range:

varies depending
probe model

Gage Size:

137 x 61 x 28 mm
5.4" x 2.4" x 1.1"

Accuracy:

varies depending
on probe model

Weight: (without batteries)

140 g
4.9 oz

Resolution:

varies depending
on probe model

Temperature Range:

+32° to +120°F
0 to +50°C

Conforms to:

ISO 2178/2360/2808, ISO 19840,
ASTMB499/D1186/D1400/D7091/E376/
G12, BS3900-C5, SSPC-PA2 and others

This device complies with part 15 of the FCC Rules. Operation is subject to the following two conditions: (1) This device may not cause harmful interference, and (2) this device must accept any interference received, including interference that may cause undesired operation.

Returning for Service

Before returning the instrument for service...

1. Install new batteries in the proper alignment as shown within battery compartment.
2. Examine the sensor for debris or damage.
3. Perform a **Hard Reset**. (see pg. 14)
4. If issue is not resolved, **Update** (pg. 30) your **PosiTector** gage body and re-attempt measurements.

IMPORTANT: If you must return the Gage for service, please fill out and include the Service Form located at www.defelsko.com/support with the Gage. Be sure to also include the probe, your company name, company contact, telephone number and fax number or email address.

Limited Warranty, Sole Remedy and Limited Liability

DeFelsko's sole warranty, remedy, and liability are the express limited warranty, remedy, and limited liability that are set forth on its website:

www.defelsko.com/terms

DeFelsko[®]
The Measure of Quality

www.defelsko.com

© DeFelsko Corporation USA 2017
All Rights Reserved

This manual is copyrighted with all rights reserved and may not be reproduced or transmitted, in whole or part, by any means, without written permission from DeFelsko Corporation.

DeFelsko and PosiTector are trademarks of DeFelsko Corporation registered in the U.S. and in other countries. Other brand or product names are trademarks or registered trademarks of their respective holders.

Every effort has been made to ensure that the information in this manual is accurate. DeFelsko is not responsible for printing or clerical errors.

DeFelsko®

Simple. Durable. Accurate.



www.defelsko.com

© DeFelsko Corporation USA 2017

All Rights Reserved

This manual is copyrighted with all rights reserved and may not be reproduced or transmitted, in whole or part, by any means, without written permission from DeFelsko Corporation.

DeFelsko, PosiTector and PosiSoft are trademarks of DeFelsko Corporation registered in the U.S. and in other countries. Other brand or product names are trademarks or registered trademarks of their respective holders.

Every effort has been made to ensure that the information in this manual is accurate. DeFelsko is not responsible for printing or clerical errors.